


FASTENING FIXTURES TO PLASTIC PROFILES



Flat countersunk head, cross recess, type H

With breaking ribs, needle point, case hardened, slide-coated

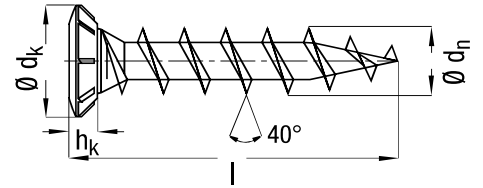

Special surface silver A3J

Dimensions [mm]					Packaging Units	FSA Part NO.
Thread \emptyset d_1	Length total l	Head \emptyset d_k	Head height h_k	BIT size cross recess H	SPAX BOX [pieces]	
4.0	16	7.0	2.4	2	1,000	SP-FEX-KS 4x16
	20	7.0	2.4	2	1,000	SP-FEX-KS 4x20
	22	7.0	2.4	2	1,000	SP-FEX-KS 4x22
	25	7.0	2.4	2	1,000	SP-FEX-KS 4x25
	30	7.0	2.4	2	1,000	SP-FEX-KS 4x30
	35	7.0	2.4	2	1,000	SP-FEX-KS 4x35
	40	7.0	2.4	2	1,000	SP-FEX-KS 4x40

FEX-KS

Countersunk head fitting screw for fastening fixtures to plastic profiles.

The features at a glance:

- **Head:** Special countersunk head with breaking ribs. The special design ensures that the head is properly driven home. The restraining ribs increase the over-tightening torque, thus preventing over-tightening, especially in connection with thin-walled plastic profiles.

Repair screw for plastic profiles

5.0	40	7.0	2.4	2	1,000	SP-REP 4x40
------------	----	-----	-----	---	-------	-------------



Application example



Flat countersunk head with breaking ribs




Self-tapping point



FASTENING FITTINGS TO PLASTIC PROFILES WITH REINFORCEMENT



Flat countersunk head, cross recess, type H
 With milled ribs, drill point, case hardened, slide-coated

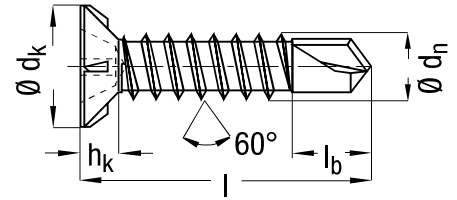


Special surface silver A3J

Dimensions [mm]						Packaging Units	FSA Part NO.
Thread Ø d1	Length total l	Length of drill point lb	Head Ø dk	Head height hk	BIT size cross recess H	SPAX BOX [pieces]	
3.9	13	4.5	7.5	2.3	2	1,000	SP-FEX-A 3.9x13
	16	4.5	7.5	2.3	2	1,000	SP-FEX-A 3.9x16
	19	4.5	7.5	2.3	2	1,000	SP-FEX-A 3.9x19
	25	4.5	7.5	2.3	2	1,000	SP-FEX-A 3.9x25
	32	4.5	7.5	2.3	2	1,000	SP-FEX-A 3.9x32
	38	4.5	7.5	2.3	2	1,000	SP-FEX-A 3.9x38

FEX-A

The screw for windows construction for attaching fittings to single-walled plastic profiles, with the reinforcement in direct contact with the reinforcement chamber. Milled ribs facilitate the insertion of the screw head.

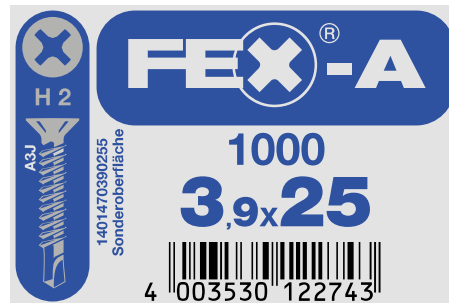

Application example



Flat countersunk head with breaking ribs



Self-tapping point

